


DB37 Male  
Connector on Quadserial bracket

DB37 Female

Adapter

DB9 Female

RXD+0	1
RXD-0	20
TXD+0	2
TXD-0	21
R_HSK+0	3
R_HSK-0	22
T_HSK+0	4
T_HSK-0	23
GND	5
RXD+1	24
RXD-1	6
TXD+1	25
TXD-1	7
R_HSK+1	26
R_HSK-1	8
T_HSK+1	27
T_HSK-1	9
GND	28
RXD+2	10
RXD-2	29
TXD+2	11
TXD-2	30
R_HSK+2	12
R_HSK-2	31
T_HSK+2	13
T_HSK-2	32
GND	14
RXD+3	33
RXD-3	15
TXD+3	34
TXD-3	16
R_HSK+3	35
R_HSK-3	17
T_HSK+3	36
T_HSK-3	18
GND	37
	19

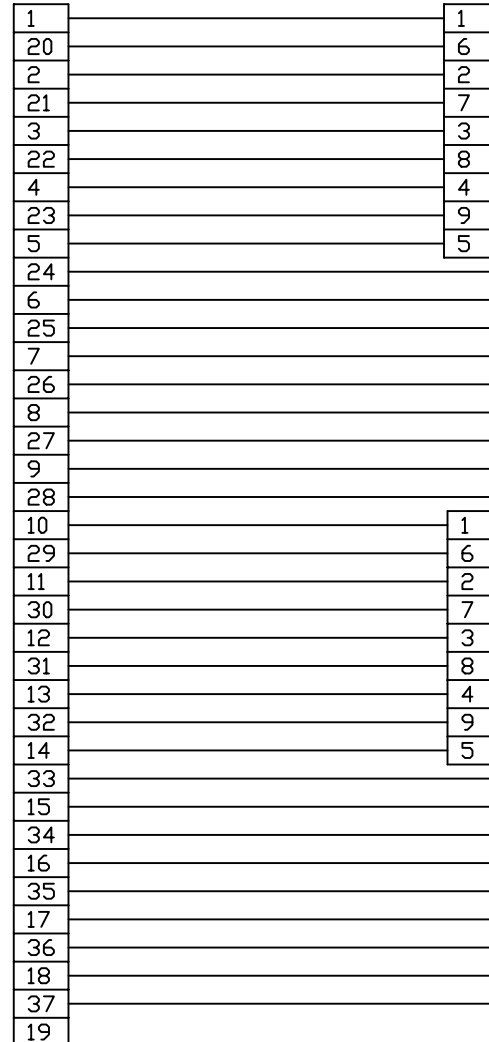

1	RXD+0
6	RXD-0
2	TXD+0
7	TXD-0
3	R_HSK+0
8	R_HSK-0
4	T_HSK+0
9	T_HSK-0
5	GND

Channel 0

1	RXD+1
6	RXD-1
2	TXD+1
7	TXD-1
3	R_HSK+1
8	R_HSK-1
4	T_HSK+1
9	T_HSK-1
5	GND

Channel 1

1	RXD+2
6	RXD-2
2	TXD+2
7	TXD-2
3	R_HSK+2
8	R_HSK-2
4	T_HSK+2
9	T_HSK-2
5	GND

Channel 2

1	RXD+3
6	RXD-3
2	TXD+3
7	TXD-3
3	R_HSK+3
8	R_HSK-3
4	T_HSK+3
9	T_HSK-3
5	GND

Channel 3

SCIENCE ENGINEERING ASSOCIATES  
P.O.Box 605  
114 C Mansfield Hollow Rd  
Mansfield Center, CT 06250  
Tel:(860)450-1717 Fax:(860)450-1707

Title  
Quad Serial Connector & Adapter Pin Out

Plotting Inch = Drawing Inch 1 = 1	File Name Quadserial-E-01
---------------------------------------	------------------------------

Date 10/14/04	Sheet 1 of 1
------------------	-----------------